


TORQUE WRENCH, PRESET TYPE

Calibration Certificate Included
Test Report Traceability Chart



Preset type torque wrench.
When preset torque has been reached, a click sound will occur with slight force from the wrench.

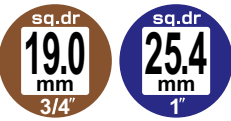

Models	Torque Range (N·m)	Increments	Units	Handle type	Sq.dr A (mm)	Dimensions (mm)				Hand force at Max. torque (N)	Weight (kg)	Case Dimensions
						B	H	T	L			
T6L420N	60 ~ 420	2	N·m	I	19.0	54	42.7	21.0	965	486	3.3	1,050 × 105 × 80
T6L700N	100 ~ 700	5	N·m	II	19.0	68	49.5	27.5	1314	708	6.2	1,200 × 180 × 98
T8L850N	100 ~ 850	5	N·m	II	25.4	76	58.0	29.0	1388	680	8.5	1,200 × 180 × 98
T8L1000N	100 ~ 1,000	5	N·m	II	25.4	76	58.0	29.0	1538	714	8.8	1,200 × 180 × 98
T8L1500N	200 ~ 1,500	10	N·m	II	25.4	87	61.0	32.5	1844	824	14.0	1,200 × 180 × 98
T8L2100N	700 ~ 2,100	10	N·m	II	25.4	87	61.0	32.5	2064	1123	19.5	1,770 × 176 × 90

※ T8L850N - T8L2100N are plunger type.

- N·m specification
- Torque Accuracy ± 3%

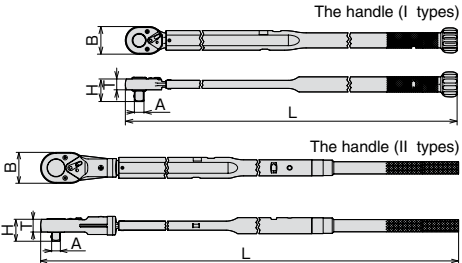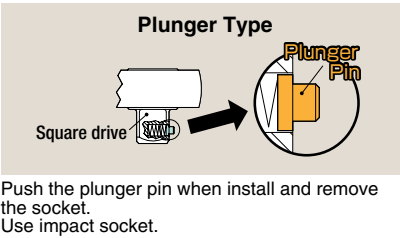

Accessory (1 for each)							
	T6L420N	T6L700N	T8L850N	T8L1000N	T8L1400N	T8L1500N	T8L2100N
Extension Handle	—	○	○	○	○	○	○
Box Wrench	—	8mm	8mm	8mm	10mm	10mm	10mm
Calibration Certificate W/H Traceability	○	○	○	○	○	○	○
Instruction Manual	○	○	○	○	○	○	○
Metal Case	○	○	○	○	○	○	—

※ T8L2100N is Carton box case

Expire Date of Calibration Certificate

1. When not in use, the product can stay up to 3 years after calibration date mentioned in the certificate.
2. If the usage started after 3 years from calibration date, it can be used up to 1 year since the first usage or up to 10,000 tightening times.

Repair・Maintenance

- Inaccuracy may occur if not used for a long time or impropriate use of tool. Please contact your distributor regularly for accuracy check.
- Torque devices require regular inspection (once a year or 10,000 times afterwards). Checking service is available with service charge.
- Please contact your distributor in case of experiencing tool malfunction (no clicking sound, slight force, etc.)
- For more information about tool handling, please contact your distributor.
- Accuracy range after repair will be ± 4%.